


three inches = one foot
one and one half inches = one foot
one inch = one foot
three quarters inch = one foot
one half inch = one foot
three eighths inch = one foot
one quarter inch = one foot
one eighth inch = one foot

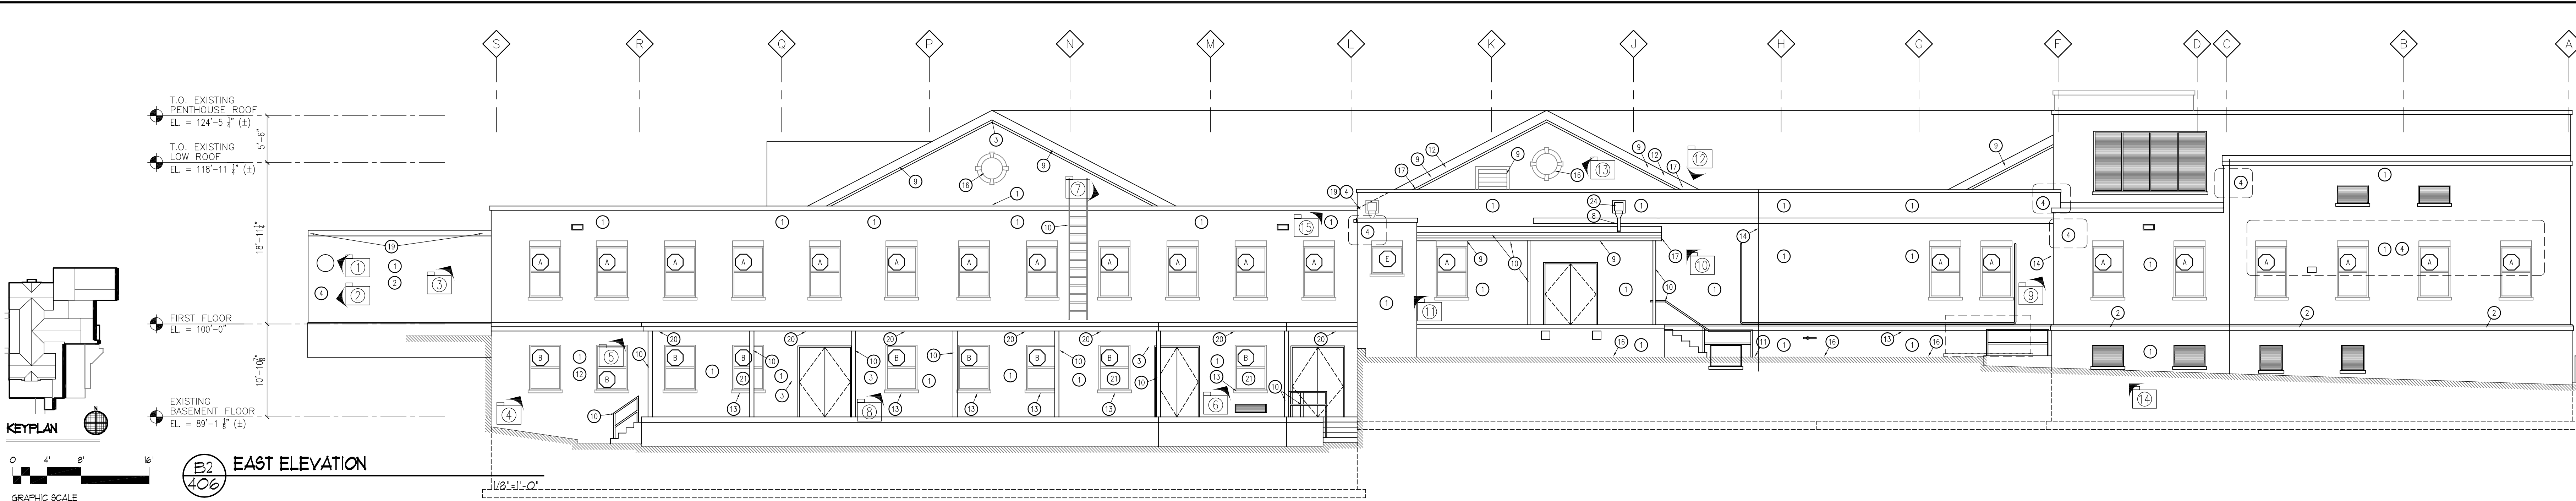

- SYMBOLS LEGEND**
- SEALANT REPLACEMENT
 - DTL SHI DETAIL REFERENCE
 - DIRECTIONAL PHOTO REFERENCE-SEE NUMBER BELOW EACH PHOTO
 - KEY NOTE
 - WINDOW TYPE, SEE SHEET AS-890
 - EXISTING COLUMN LINE

- GENERAL NOTES**
- A. REFER TO SYMBOLS LEGEND, GENERAL NOTES, KEYNOTES AND DRAWINGS FOR EXTENT OF WORK.
 - B. VERIFY ALL DIMENSIONS AND CONDITIONS AT JOB SITE. PORTIONS OF EXISTING CONSTRUCTION MAY HAVE BEEN MODIFIED BY OWNER.
 - C. MAINTAIN CONTINUOUS UTILITY SERVICE TO ALL SPACES IN THE BUILDING NOT AFFECTED BY THIS WORK. COORDINATE WITH COTR ANY DISRUPTION IN SERVICES REQUIRED TO PERFORM WORK OR TO MODIFY EXISTING PIPING, DUCTWORK OR ANY ASSOCIATED EQUIPMENT.
 - D. ANY ADJACENT WORK DAMAGED DURING SEALANT OR MORTAR REMOVAL SHALL BE REMOVED COMPLETELY AND NEW MATERIALS INSTALLED AT NO COST TO THE OWNER.
 - E. CLEAN ALL SURFACES OF MASONRY WALLS AND STONE UNITS TO PROVIDE A UNIFORM CLEAN APPEARANCE.
 - F. THE ELEVATIONS AND PHOTOGRAPHS IN THESE DOCUMENTS ILLUSTRATE THE EXISTING CONDITIONS OF THE BUILDING EXTERIOR. THE NOTATIONS DO NOT LIMIT THE AREA OF WORK TO COMPLETE THE MASONRY AND STONE CLEANING, TUCKPOINTING OR REPAIR WORK.

- KEYNOTES**
- 1 REMOVE STAINS, CLEAN STONE UNITS, MASONRY UNITS AND MORTAR.
 - 2 RE-POINT MORTAR JOINTS. REMOVE LOOSE MORTAR JOINTS.
 - 3 SEAL PENETRATIONS AND OPENINGS AT EXTERIOR WALL.
 - 4 REPLACE DAMAGED/MISSING BRICKS, CLEAN SURFACE, AND TUCKPOINT ADJACENT MORTAR JOINTS.
 - 5 CLEAN AND PREP RUSTED STEEL LINTEL / METAL CLADDING. PAINT LINTEL TO MATCH BRICK. PAINT METAL CLADDING TO MATCH EXISTING.
 - 6 INSPECT AREA. TUCKPOINT MORTAR JOINTS WHERE REQUIRED.
 - 7 REBUILD CORNER AND PROVIDE NEW BRICK EXPANSION JOINT (BEJ).
 - 8 ADD NEW DOWNSPOUT TO MATCH EXISTING DOWNSPOUT.
 - 9 REMOVE PEELING PAINT. CLEAN AND PREP ALL WOOD AREAS, INCLUDING SOFFITS. REPLACE ANY DETERIORATING WOOD AND REPLACE TO MATCH EXISTING. PRIME AND PAINT WOOD SURFACES TO MATCH EXISTING.
 - 10 REMOVE PEELING PAINT. CLEAN AND PREP METAL ITEMS INCLUDING METAL FACIA, STEEL RAILINGS, BEAMS, POSTS AND COLUMNS. PRIME AND PAINT TO MATCH EXISTING.
 - 11 REPAIR SPALLING CONCRETE AT STOOP.
 - 12 REMOVE VEGETATION GROWTH AND DEBRIS FROM BRICKS AND OTHER BLDG COMPONENTS. CLEAN BRICKS AND MORTAR.
 - 13 REPAIR OR REPLACE DAMAGED CONCRETE UNITS TO MATCH EXISTING. CLEAN AND REMOVE STAINS.
 - 14 REPLACE BRICK EXPANSION JOINT SEALANT. REMOVE EXISTING SEALANT, CLEAN AND PREP JOINT. PROVIDE NEW BACKER ROD AND SEALANT.
 - 15 REINSTALL AND SECURE LOOSE LIGHTNING PROTECTION CABLE.
 - 16 REMOVE AND REPLACE SEALANT JOINT. CLEAN MASONRY UNITS.
 - 17 REPAIR AND REPLACE DAMAGED ROOFING MATERIAL AND FLASHING.
 - 18 PROVIDE MISSING DOWNSPOUT. REPAIR AND CONNECT TO SCUPPER.
 - 19 REPLACE DAMAGED/MISSING COPING AND FLASHING TO MATCH EXISTING.
 - 20 REPLACE DAMAGED PLASTER / GYP. ED. SOFFIT. PATCH HOLES AND PAINT TO MATCH EXISTING.
 - 21 REPLACE DAMAGED WINDOW SCREEN.
 - 22 REMOVE EXISTING STORM SEWER SLEEVE AND CAP AS NECESSARY.
 - 23 PROVIDE AND INSTALL NEW GUTTER.
 - 24 NEW RELIEF SCUPPER.
 - 25 NEW LOUVER. REFER TO HVAC DRAWINGS.



EAST ELEVATION 1



EAST ELEVATION 2



EAST ELEVATION 3



EAST ELEVATION 4



EAST ELEVATION 5



EAST ELEVATION 6



EAST ELEVATION 7



EAST ELEVATION 8



EAST ELEVATION 9



EAST ELEVATION 10



EAST ELEVATION 11



EAST ELEVATION 12










EAST ELEVATION 13



EAST ELEVATION 14



EAST ELEVATION 15

		 <div>Federal Health Care Center U.S. Department of Veterans Affairs U.S. Department of Defense</div>				<div>CONSULTANTS:</div> <div> ARNOLD & O'SHERIDAN Consulting Engineers</div> <div> CHEQUAMEGON BAY ENGINEERING, INC.</div> <div>MACKESEY AND ASSOCIATES, LLC</div>		<div>PROJECT LEADER:</div> <div> Intelligent Designs w w w . p r a r c h . c o m</div> <div> Insired Results PRA Job No. 110172-01</div>		<div>Drawing Title</div> <div>Exterior Elevations - East and Photos</div> <div>Approved: Project Director</div>		<div>Project Title</div> <div>AE SCIP for Building 6 FHCC</div> <div>Location</div> <div>North Chicago, IL</div> <div>Date</div> <div>December 14, 2012</div> <div>Checked By:</div> <div>PRA</div> <div>Drawn By:</div> <div>RLS</div>		<div>Project Number</div> <div>556-11-119</div> <div>Building Number</div> <div>6</div> <div>Drawing Number</div> <div>AS-406</div>		<div>Office of Facilities Management</div> <div> Department of Veterans Affairs</div>	
FINAL BID DOCUMENTS		12-14-12		<div>Captain James A. Lovell Federal Health Care Center 3001 Green Bay Road North Chicago, IL, 60064</div>													
95% CONSTRUCTION DOCUMENT SUBMISSION		11-26-12															
50% REVISED DOCUMENTS FOR REVIEW		11-19-12															
90% CONSTRUCTION DOCUMENTS SUBMISSION		05-17-12															
50% CONSTRUCTION DOCUMENTS SUBMISSION		04-06-12															
35% DOCUMENTS SUBMISSION		02-22-12															
SCHEMATIC DESIGN SUBMISSION		11-21-11															
Revisions:		Date															